

2

FINAL REPORT

JANUARY 1988

AD-A207 067

EVT 38-87-3
MIL-STD-1660 ENGINEERING TEST
OF
48" X 40" STANDARD METAL
PALLET USING REVERSE
LIGHTENING HOLES AND
METAL TOP LIFT


DTIC
ELECTE
APR 26 1989
S D CS D

DISTRIBUTION STATEMENT A

Approved for public release
Distribution Unlimited

Prepared for:
Project Manager for Ammunition Logistics
ATTN: AMCPM-AL
Picatinny Arsenal, NJ 07806-5000

Distribution Unlimited

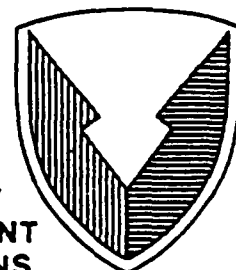

US ARMY
ARMAMENT
MUNITIONS
CHEMICAL COMMAND

US ARMY DEFENSE AMMUNITION
CENTER AND SCHOOL

EVALUATION DIVISION
SAVANNA, ILLINOIS 61074-9639

000 1 24 007

AVAILABILITY NOTICE

A copy of this report is furnished each attendee on automatic distribution. Additional copies or authority for reprinting may be obtained by written request from Director, U.S. Army Defense Ammunition Center and School, ATTN: SMCAC-DEV, Savanna, IL 61074-9639.

DISPOSITION INSTRUCTIONS

Destroy this report when no longer needed. Do not return.

* * *

Citation of trade names in this report does not constitute an official endorsement.

* * *

The information contained herein will not be used for advertising purposes.

REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

1a. REPORT SECURITY CLASSIFICATION UNCLAS			1b. RESTRICTIVE MARKINGS		
2a. SECURITY CLASSIFICATION AUTHORITY			3. DISTRIBUTION / AVAILABILITY OF REPORT UNLIMITED		
2b. DECLASSIFICATION / DOWNGRADING SCHEDULE					
4. PERFORMING ORGANIZATION REPORT NUMBER(S) EVT 38-87-3			5. MONITORING ORGANIZATION REPORT NUMBER(S)		
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Defense Ammunition Center and School		6b. OFFICE SYMBOL (If applicable) SMCAC-DEV		7a. NAME OF MONITORING ORGANIZATION Project Manager for Ammunition Logistics ATTN: AMCPM-AL	
6c. ADDRESS (City, State, and ZIP Code) Savanna, IL 61074-9639			7b. ADDRESS (City, State, and ZIP Code) Picatinny Arsenal, NJ 07806-5000		
8a. NAME OF FUNDING / SPONSORING ORGANIZATION Project Manager for Ammunition Logistics		8b. OFFICE SYMBOL (If applicable) AMCPM-AL		9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER	
8c. ADDRESS (City, State, and ZIP Code) Picatinny Arsenal, NJ 07806-5000			10. SOURCE OF FUNDING NUMBERS		
			PROGRAM ELEMENT NO.	PROJECT NO.	TASK NO.
			WORK UNIT ACCESSION NO.		
11. TITLE (Include Security Classification) MIL-STD-1660 Test of 48" x 40" Standard Metal Pallet Using Reverse Lightening Holes and Metal Top Lift					
12. PERSONAL AUTHOR(S) Quinn Hartman					
13a. TYPE OF REPORT FINAL		13b. TIME COVERED FROM _____ TO _____		14. DATE OF REPORT (Year, Month, Day) January 1988	
15. PAGE COUNT 22					
16. SUPPLEMENTARY NOTATION					
17. COSATI CODES			18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
19. ABSTRACT (Continue on reverse if necessary and identify by block number)					
<p>The U.S. Army Defense Ammunition Center and School (USADACS), Evaluation Division (SMCAC-DEV), has been tasked by the Project Manager for Ammunition Logistics (PM-AMMOLOG), Picatinny Arsenal, NJ, to design, fabricate and test a Standard Metal Pallet. This report contains the procedures, results and recommendations from the MIL-STD-1660 engineering test that was conducted on one prototype design of the 48" x 40" pallet. As a result of the pallet's performance during the test, recommendations for redesign of the pallet evolved.</p>					
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION		
22a. NAME OF RESPONSIBLE INDIVIDUAL Quinn Hartman			22b. TELEPHONE (Include Area Code) 815-273-8929		22c. OFFICE SYMBOL SMCAC-DEV


U.S. ARMY DEFENSE AMMUNITION CENTER AND SCHOOL

Evaluation Division

Savanna, IL 61074-9639

REPORT NO. EVT 38-87-3

MIL-STD-1660 ENGINEERING TEST OF
48" x 40" STANDARD METAL PALLET USING REVERSE
LIGHTENING HOLES AND METAL TOP LIFT

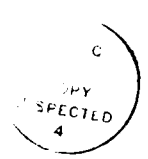

Accession For	
NTIS CRA&I	
DTIC TAB	
Unannounced	
Justification:	
By	
Distribution /	
Availability Codes	
Dist	Avail and/or Special
A-1	

TABLE OF CONTENTS

	PAGE NO.
PART 1 - INTRODUCTION	1-1
A. Background	1-1
B. Authority	1-1
C. Objective	1-1
PART 2 - ATTENDEES	2-1
PART 3 - TEST PROCEDURES	3-1
PART 4 - TEST EQUIPMENT	4-1
PART 5 - TEST RESULTS	5-1
PART 6 - CONCLUSIONS AND RECOMMENDATIONS	6-1
PART 7 - PHOTOGRAPHS	7-1
PART 8 - DRAWINGS	8-1

PART 1

INTRODUCTION

A. BACKGROUND. The U.S. Army Defense Ammunition Center and School, Evaluation Division, was tasked by the Project Manager for Ammunition Logistics (PM-AMMOLOG), AMCPM-AL, to design, test, and evaluate a 48' x 40' standard metal pallet. For this test, a metal pallet equipped with reverse lightening hole posts and metal top lift was loaded with M548 containers. (See Drawings for details on reverse lightening hole posts). The test procedure for evaluating the metal pallet is MIL-STD-1660, Design Criteria for Ammunition Unit Loads.

B. AUTHORITY. This test was conducted in accordance with mission responsibilities delegated by the U.S. Army Armament, Munitions and Chemical Command, Rock Island, IL.

C. OBJECTIVE. The objective of these tests is to assess the metal pallet's capability to meet Army functional/operational requirements for MIL-STD-1660, Design Criteria for Ammunition Unit Loads.

PART 2

ATTENDEES

Quinn Hartman
Test Engineer

U.S. Army Defense Ammunition Center and School
ATTN: SMCAC-DEV
Savanna, IL 61074-9639
AV 585-8989

PART 3
TEST PROCEDURES

The test procedures outlined in this section were extracted from MIL-STD-1660, Design Criteria for Ammunition Unit Loads dated 8 April 1977. This standard identifies nine steps that a unitized load must undergo if it is considered to be acceptable. The 2 tests that were conducted on the sample pallet are synopsized below:

1. STACKING TESTS. The unit load shall be loaded to simulate a stack of identical unit loads stacked 16-feet high, for a period of one hour. This stacking load is simulated by subjecting the unit load to a compression of weight equal to an equivalent 16-foot stacking height. The compression load is calculated in the following manner. The unit load weight is divided by the unit load height in inches and multiplied by 192. The resulting number is the equivalent compressive force of a 16-foot high load.

2. REPETITIVE SHOCK TEST. The repetitive shock test shall be conducted in accordance with Method 5019, Federal Standard 101. The test procedure is as follows. The test specimen shall be placed on, but not fastened to, the platform. With the specimen in one position, vibrate the platform at 1/2-inch amplitude (1-inch double amplitude) starting at a frequency of about 3 cycles per second. Steadily increase the frequency until the package leaves the platform. The resonant frequency is achieved when a 1/16-inch thick feeler may be momentarily slid freely between every point on the specimen in contact with the platform at some instance during the cycle or a platform acceleration

achieves one plus or minus zero point one G. Midway into the testing period the specimen shall be rotated 90-degrees and the test continued for the duration. Unless failure occurs, the total time of vibration shall be two hours if the specimen is tested in one position; and if tested in more than one position, the total time shall be three hours.

PART 4
TEST EQUIPMENT

1. TEST SPECIMEN.

- a. Drawing Number:
- b. Width: 37-1/2 inches
- c. Length: 50-1/2 inches
- d. Height: 48-3/4 inches
- e. Weight: 4,250 pounds

2. COMPRESSION TESTER.

- a. Manufacturer: Ormond Manufacturing
- b. Platform: 60 inches by 60 inches
- c. Compression Limit: 50,000 pounds
- d. Tension Limit: 50,000 pounds

3. TRANSPORTATION SIMULATOR.

- a. Manufacturer: Gaines Laboratory
- b. Capacity: 6,000-pound pallet
- c. Displacement: 1/2-inch Amplitude
- d. Speed: 50 to 400 rpm
- e. Platform: 5 foot by 8 foot

4. INCLINED RAMP.

- a. Manufacturer: Conbur Incline
- b. Type: Impact Tester
- c. Grade: 10% Incline
- d. Length: 12-foot Incline

PART 5

TEST RESULTS

1. STACKING TEST.

Pallet Weight - 4,250 pounds
Pallet Height - 48-3/4 inches
Test Load - 16,800 pounds

The test pallet was loaded to 16,800 pounds compression for a period of one hour. At the end of the 1 hour period, the compression load had decreased to 15,000 pounds and the load had compressed 1/2 inch. After the test pallet was removed from the compression table, a deformation of 1/4 inch was noted. No damage was evident in the load or the pallet.

2. REPETITIVE SHOCK TEST.

The test pallet successfully passed the lateral transportation simulation but was considered to have failed the longitudinal simulation when the center skid broke loose from the pallet. The remaining outer skids were severely damaged and fell off the pallet base when the load was removed from the transportation simulator. Failure of the pallet appeared to have occurred in the struts at the bend next to the skids. The bend first developed cracks and then broke from the constant pounding that the pallet is subject to during the transportation simulation. Duration of the test was 90 minutes for each orientation of the pallet. In order to achieve the required 1/16-inch clearance between the pallet and the transportation simulator bed, the equipment was operated at 220 rpm.


PART 6

CONCLUSIONS AND RECOMMENDATIONS

1. CONCLUSIONS. The pallet successfully passed both the stacking test and the lateral portion of the transportation simulation. During the second half of the transportation simulation, the test was stopped when the center skid broke loose from the pallet base. The weak point of the pallet that appears to have failed first was at the bend in the posts next to the skids.

2. RECOMMENDATIONS. It is recommended that this pallet not be used to transport military loads until design changes are made to the pallet that will enable it to pass the MIL-STD-1660 test criteria. The critical area on the pallet that needs to be modified is the posts that connect the skid to the pallet base. Recommendations for changes to the pallet design would be to use a heavier gauge metal for the posts or add a piece of metal to the inside of the strut to reinforce the bends next to the skids.

PART 7
PHOTOGRAPHS

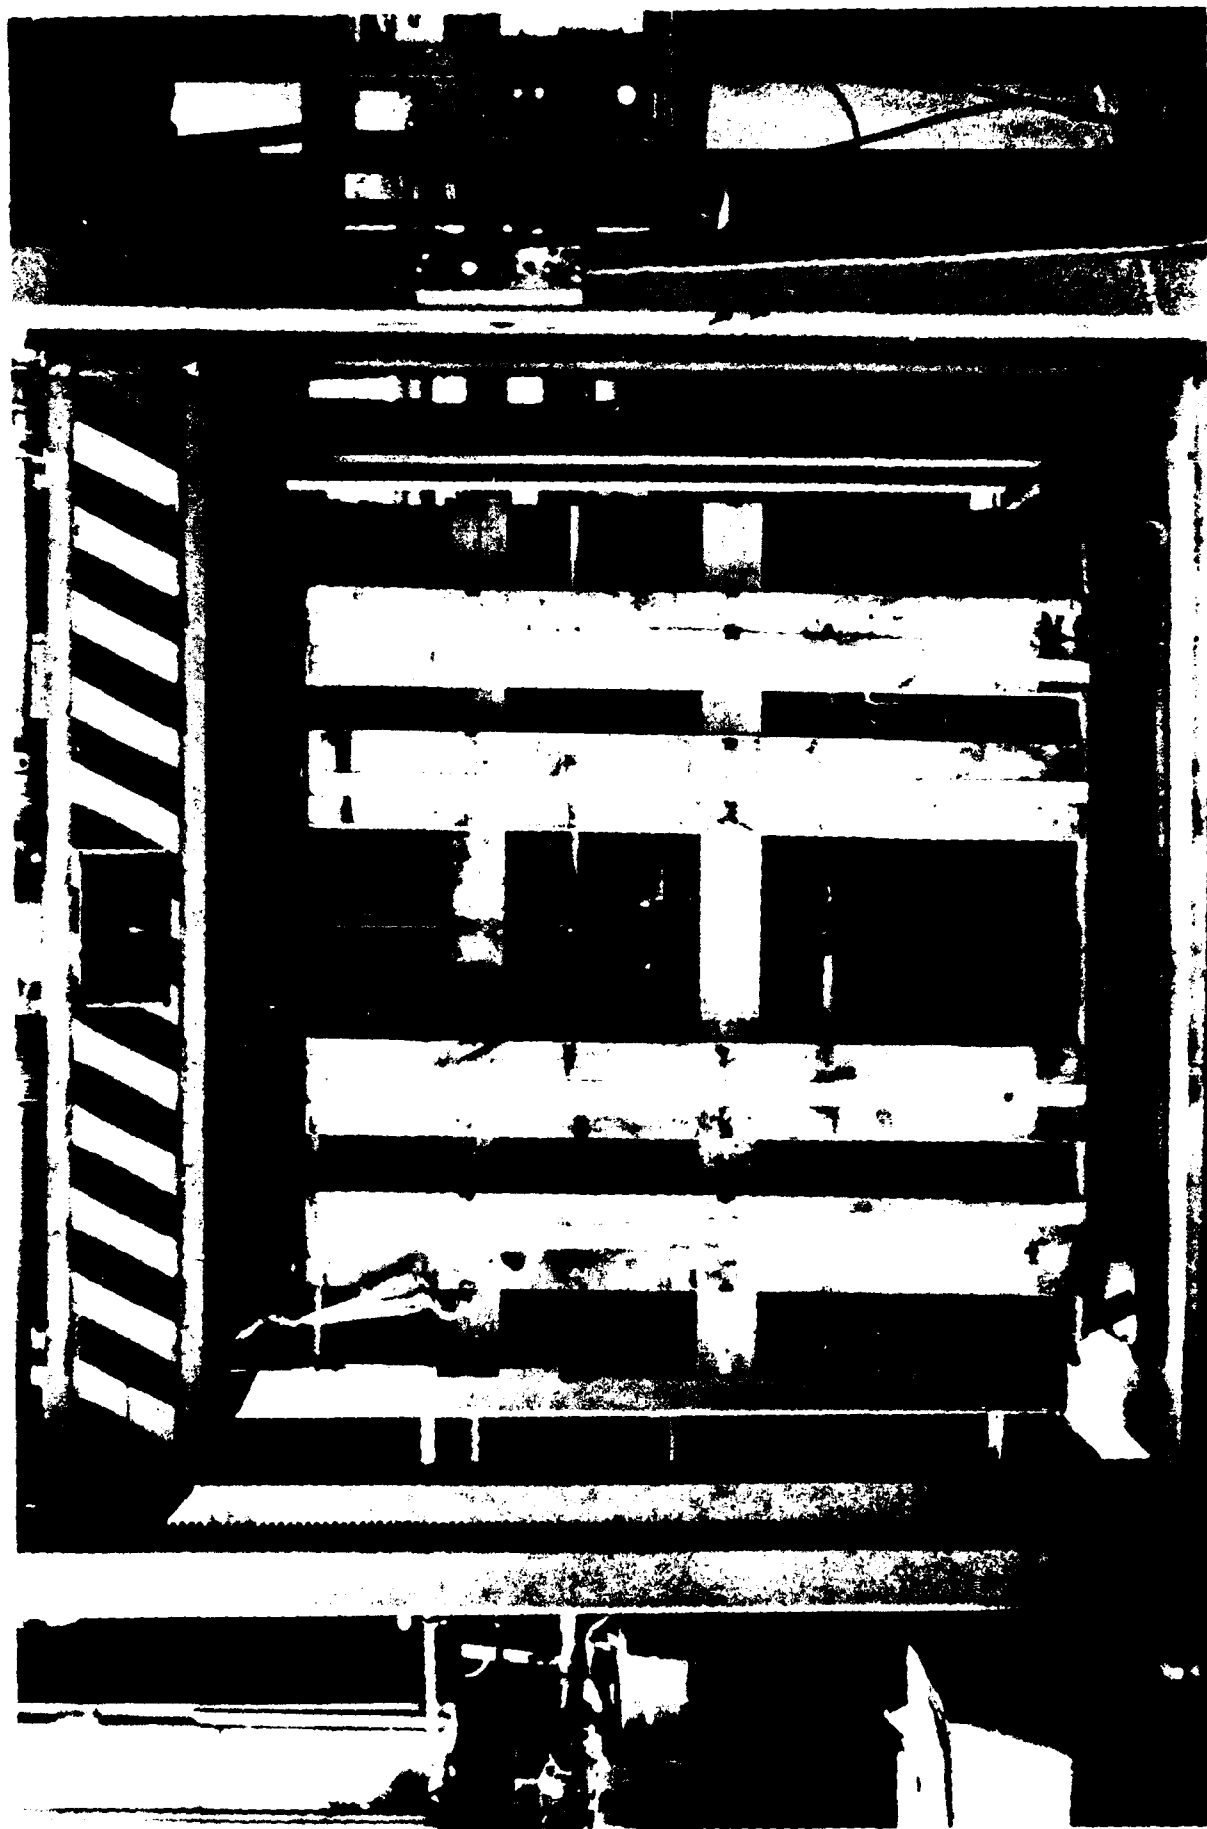

DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 1. This photo shows the metal pallet loaded with M548 cans in the Compression Tester.



DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 2. This photo shows the M548 cans and pallet in the Transportation Simulator in the Lateral Orientation.



DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 3. This photo shows the M548 cans and pallet in the Transportation simulator in the Longitudinal Orientation at the end of the test.




DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 4. This photo shows the location of the break in the posts.



DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 5. This photo shows the position of the middle skid at the end of the longitudinal portion of the Transportation Simulation.

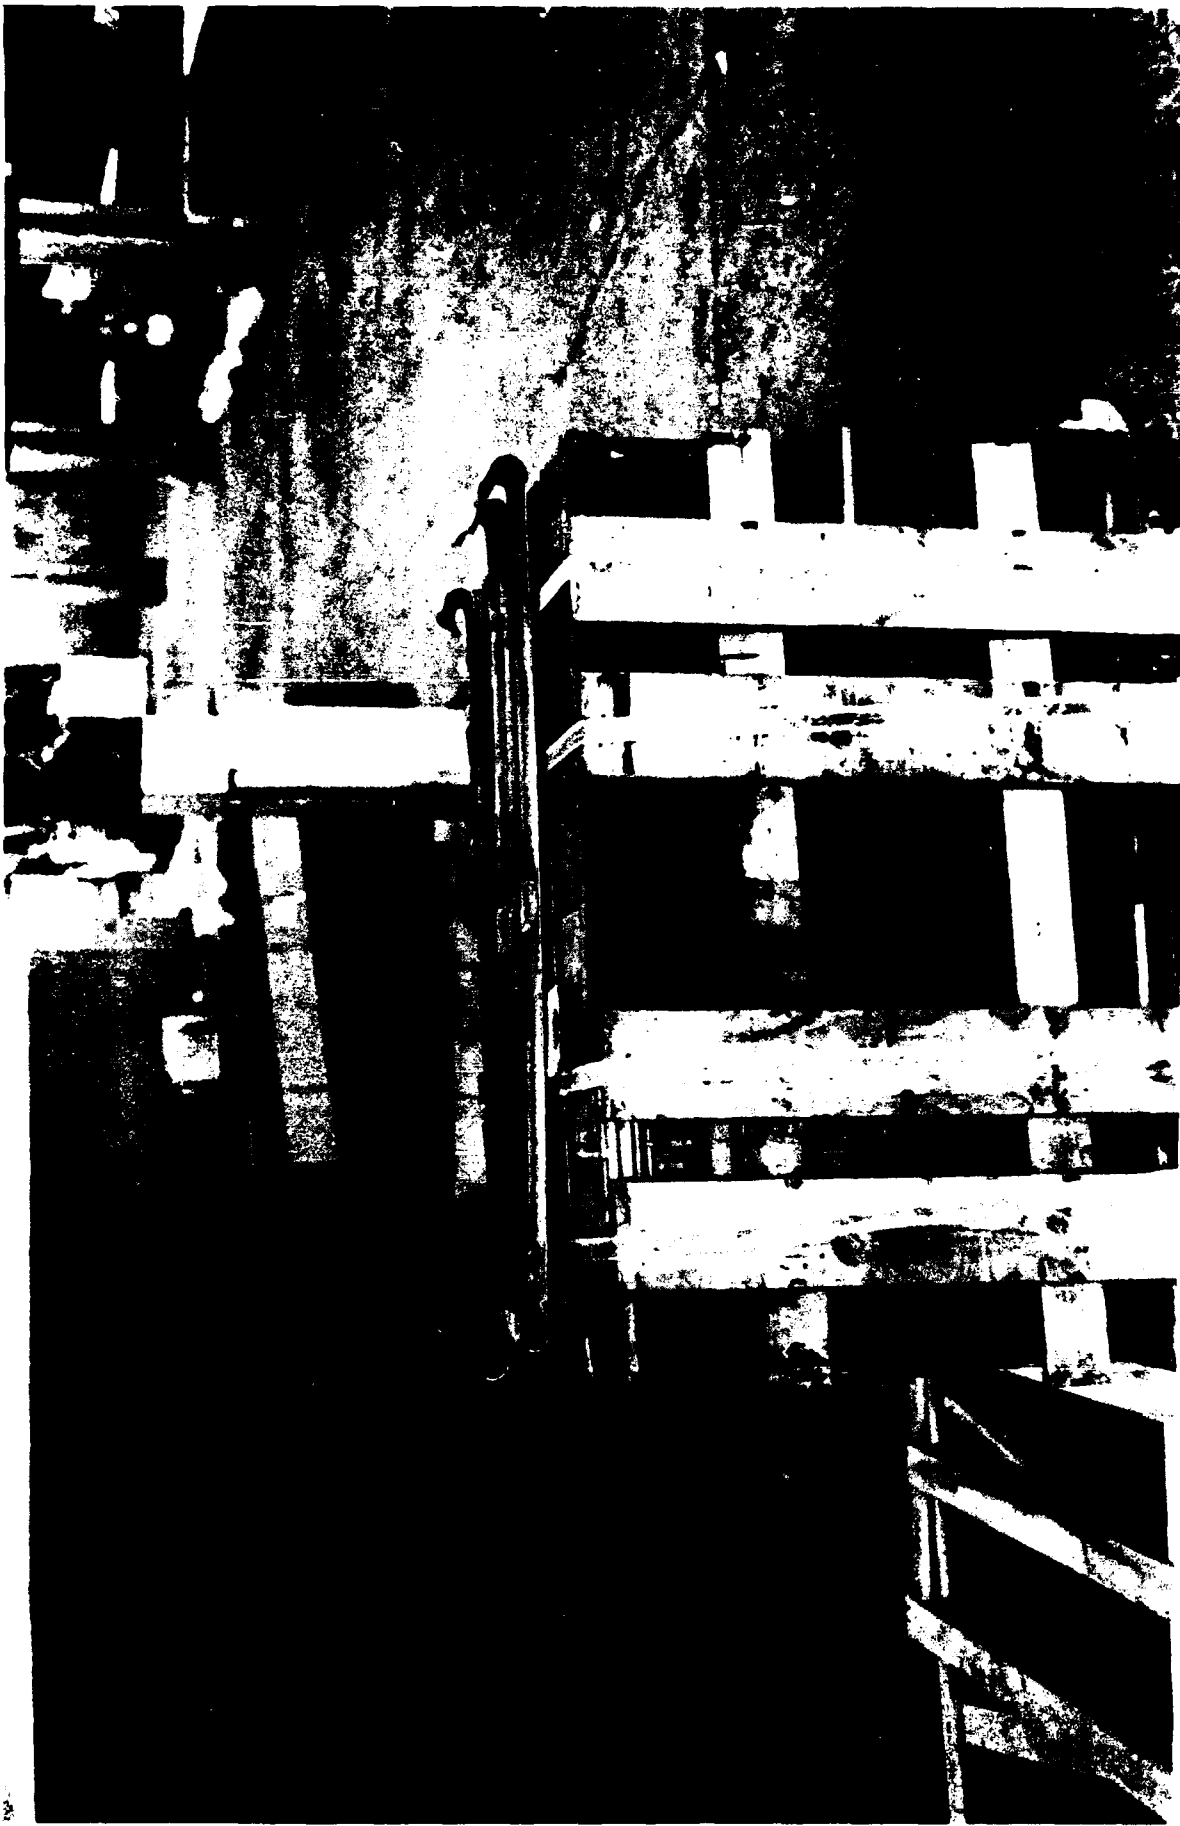


DEFENSE AMMUNITION CENTER AND SCHOOL - SAVANNA, IL

Photo 6. This photo shows the condition of the pallet after it was removed from the Transportation Simulator.

PART 8
DRAWINGS

Methodology

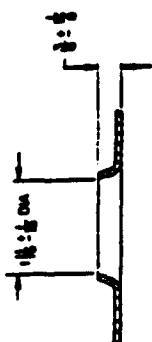

SECTION A-A

1. BEND EACH 1/8" MAX. MORE NOT NOTED
2. MATERIAL: SHY SAE OR ANNEAL STEEL, HARDEN, COIL ROLLED OR NOT ROLLED, PER ASTM A366 (ASTN A366 OR A366)
3. ALL DIMENSIONS ARE IN INCHES

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100	1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86
--	--	--	--	--	---